



SOFTWARE RELEASE NOTES

MCS-CONNECT Version 17.05.05 9/18/2015

Updates from previous versions:

Bug Fixes:

1. The new Plant manager code was not being checked for lockouts. I added checks to determine if I should send a lockout reset message to the controller.
2. The new Condenser Status iFrame is not being tracked by the Workspace Setup. Added code to save its location in workspaces in which it appears.
3. The alert@mcscontrols.com email address stopped working as an outgoing server for alarm alerts. This was caused by our migration to a new email server that was using smtp instead of pop3. I changed the sendMail() function to reflect this change.
4. Deleting multiple sites from the Main Info UI causes MCS-Connect to crash. This is due to deleting an action listener and not replacing it. RESOLUTION - Added code to replace the action listener after deleting it.
5. The addition of multiple I/O board types in V14/V17 is causing an issue in the offline graph feature. The building of the AO, SI, and RO grids is being done in the old style boards due to the lack of a machine structure. RESOLUTION - Added code to use the new style for offline graphs to ensure that all points are shown.
6. The previous version change caused a bug which would not allow any V17 cfg other than CPM cfg type to reset lockouts. RESOLUTION - Changed the function to work correctly by returning the correct boolean if not CPM cfg type.
7. The Reset/Clear Menu Item in the Info UI was remaining disabled even when authorized if the Graphics lock was enabled in the mcspc2.ini file. RESOLUTION - I enabled the Menu if the graphics lock is enabled. This still would not let an unauthorized user do a lockout.

Any questions regarding this release, contact:
support@mcscontrols.com

Micro Control Systems, Inc. 5580 Enterprise Parkway Fort Myers, Florida 33905
(239)694-0089 FAX: (239)694-0031 www.mcscontrols.com

Information contained in this document has been prepared by Micro Control Systems, Inc. and is copyright © protected 2015. Copying or distributing this document is prohibited unless expressly approved by MCS.